

SURVEY FORM

The Quincy Preservation Commission, Quincy, Illinois

ADDRESS

808 North Sixth Street

Historic Property Name

Common Name

Present Owner

Telephone

Present Owner's Address

Architectural Style/Building Type

Queen Anne

Construction Date

c. 1885

Architect/Builder

Historic Use


Single family residential

Present Use

Single family residential

History (associated events, people, dates)

Appears on 1898 Sanborn Map with porch, south bay, and three 1-1/2 and 1 story wings. 1-1/2 story carriage barn with two 1 story wings (one wing open) at rear/east alley. Barn labeled garage on 1927 Sanborn Map.

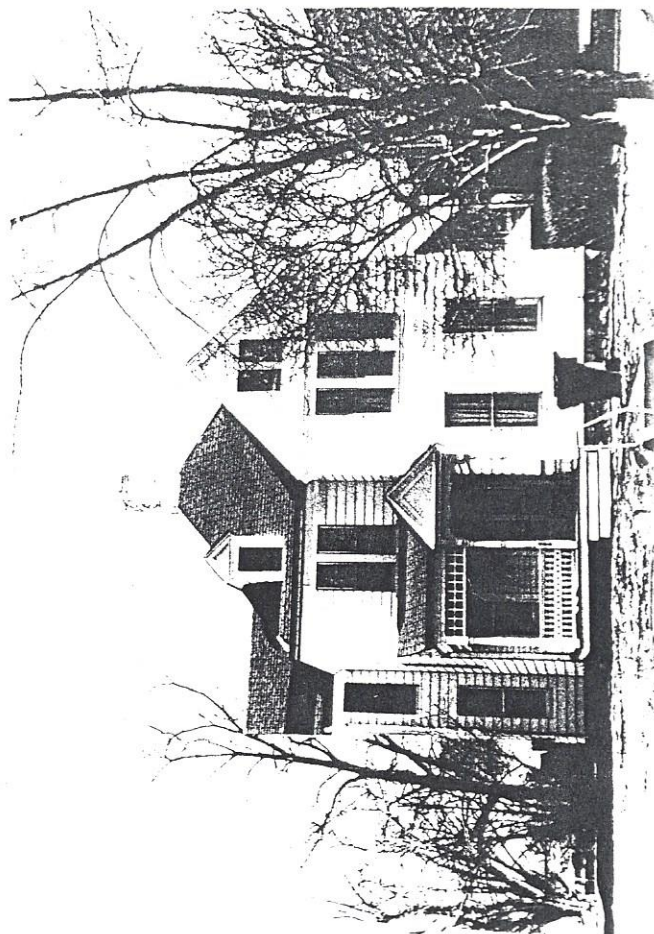

Local landmark evaluation: currently listed ☐ yes ☒ no ☐ date

If not currently listed, recommend:

Individually ☐ yes ☒ no

As part of an historic district ☒ yes ☐ no

Photo View

☐ 8 Roll Number ☒ Exterior

☐ 1 Frame Number ☐ Interior

Description (stories, shape or plan, foundation and wall materials, roof shape and material, porch, windows, decorative work, etc.)

Nearly identical to 617 Elm Street, just around the corner. 2-1/2 stories. irregular plan. random limestone foundation with "vining" (raised) mortar. artificial siding (wide white). gabled pyramidal hip roof (asphalt shingle). entrance porch left of right/south gable front pavilion extending out from small reentrant angle with steep pediment over entrance bay; starburst in pediment with scalloped cornice with incised scroll design. stylized balustrade with slat and cut-out circle patterned, turned posts; sunburst in side of shed too. 1/1 double hung sash; no surrounds with artificial siding. 2nd story sash in pairs and sets. paired fixed sash at attic in gables. leaded stained glass upper sash of 1/1 to left/north of entrance. double door entrance with transom. small gable roof dormer off-set over entrance bay front; large fixed sash. north gable wing one bay wide from front/west. 2 story gable semi-hexagonal bay south. huge central brick chimney. rear 1-1/2 story gable wing.

Under restoration by current owner who reports the artificial siding is to be removed!

Condition: ☐ Excellent ☒ Good ☐ Fair ☐ Deteriorated

Subsidiary Buildings/Site

Excellent outbuilding example: historic 1-1/2 story board and batten carriage barn with slider doors at rear alley; side gable roof (asphalt shingle) with upper story door in gable south.

Major Physical changes from original construction and dates

Wall treatment.

National Register Evaluation: Currently listed ☐ yes ☒ no ☐ date

As a ☐ contributing ☐ non-contributing property in ☐ Historic District

If not currently listed, recommend:

A. Individually ☐ yes ☒ no

B. As part of a potential historic district ☒ yes ☐ no ☒ contributing ☐ non-contributing

C. Explain rationale - A, B, C, D, or combination of any: C, Architecture

Form prepared by: The URBANA Group (Edwards)

Date: February 22, 1995